

	Report	RMA Number	68662	
Customer Inf	ormation:			
Company	US Department of Commerce, NOAA		Date	5/7/2012
Contact	Ulises Rivero			
PO Number				
Sorial Numbe	432082			

Model Number SBE 43

Services Requested:

- 1. Evaluate/Repair Instrumentation.
- 2. Perform Routine Calibration Service.

Problems Found:

1. An anode assembly failure was found.

Services Performed:

- 1. Performed initial diagnostic evaluation.
- 2. Replaced the SBE 43 Anode sub assembly.
- 3. Replaced the SBE 43 Getter sub assembly.
- 4. Replaced the lid and membrane assembly (0.5 mil).
- 5. Replaced the electrolyte with new fluid.
- 6. Performed internal inspection and O-ring replacement.
- 7. Performed hydrostatic pressure test.
- 8. Performed "Final" calibration of the oxygen sensor.
- 9. Performed full diagnostic evaluation.

Special Notes: